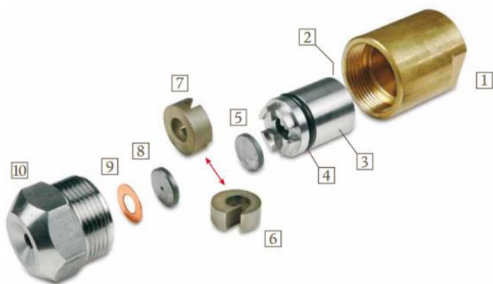


P1


Code	Description	Pos.
047XX	Body P1 3/4" 3/8"	1
04800	Gasket O-R	2
04900	Distributor P1	3
05000	Packing O-R	4
05100	Plate Tungsten Carbide	5
0520X	1 Way Swirl Sintered Steel H=4, 5, 6, 7, 8, 10, 12, 14	6
0530X	3 Way Swirl Sintered Steel H=4, 5, 6, 7, 8, 10, 12, 14	7
0540XX	Nozzle Tungsten Carbide XX= 0.7, 0.8, 1, 1.2, 1.3, 1.4, 1.5, 1.6, 1.7, 1.8, 1.9, 2, 2.1, 2.2, 2.3, 2.4, 2.5, 2.6, 2.7, 2.8, 3, 3.2, 3.4, 3.5, 3.8, 4, 4.5, 5 mm	8
05500	Copper ring	9
05600	Head P1	10


P2


Code	Description	Pos.
03000	Body P2 3/4"	1
03100	Aluminium Washer	2
03200	Distributor P2	3
05100	Plate Tungsten Carbide	5
0520X	1 Way Swirl Sintered Steel H=4, 5, 6, 7, 8, 10, 12, 14	6
0530X	3 Way Swirl Sintered Steel H=4, 5, 6, 7, 8, 10, 12	7
0540XX	Nozzle Tungsten Carbide XX= 0.7, 0.8, 1, 1.2, 1.3, 1.4, 1.5, 1.6, 1.7, 1.8, 1.9, 2, 2.1, 2.2, 2.3, 2.4, 2.5, 2.6, 2.7, 2.8, 3, 3.2, 3.4, 3.5, 3.8, 4, 4.5, 5 mm	8
05500	Copper ring	9
03300	Head P2	10

P3



Code	Description	Pos.
020XX	Body P3 3/4" 3/8"	1
02200	Distributor P3 Inox	3
02200W	Distributor P3 Tungsten Carbide	3
05000	Packing O-R	4
0210X	4 Way Swirl Tungsten Carbide H=4, 7, 10	6
0540XX	Nozzle Tungsten Carbide 19x3 XX= 0.7, 0.8, 1, 1.2, 1.3, 1.4, 1.5, 1.6, 1.7, 1.8, 1.9, 2, 2.1, 2.2, 2.3, 2.4, 2.5, 2.6, 2.7, 2.8, 3, 3.2, 3.4, 3.5, 3.8, 4, 4.5, 5 mm	8
05500	Copper ring	9
02300	Head P3	10

P4

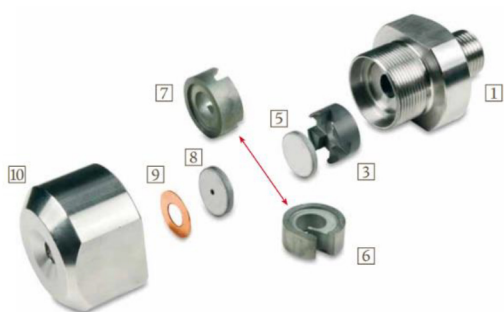

Code	Description	Pos.
06000	Body P4"	1
0610X	Distributore P4	3
05100	Plate Tungsten Carbide	5
05119XX	1 Way Swirl Tungsten Carbide H= 8, 10	6
05319XW	3 Way Swirl Tungsten Carbide 19 H= 8, 10	7
0540XX	Nozzle Tungsten Carbide XX= 0.7, 0.8, 1, 1.2, 1.3, 1.4, 1.5, 1.6, 1.7, 1.8, 1.9, 2, 2.1, 2.2, 2.3, 2.4, 2.5, 2.6, 2.7, 2.8, 3, 3.2, 3.4, 3.5, 3.8, 4, 4.5, 5 mm	8
05500	Copper ring	9
06200	Head P4	10

P5

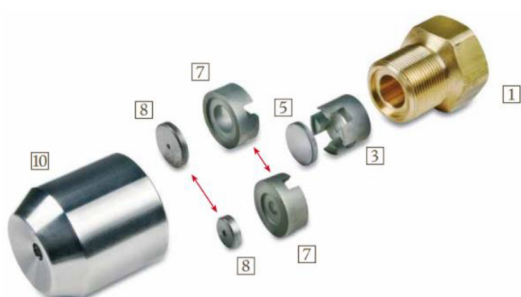

Code	Description	Pos.
070XX	Body P5 3/4" 3/8"	1
071XX	Distributore P5 (15=7+8) (15=10+5)	3
05100	Plate Tungsten Carbide	5
053136XW	3 Way Swirl Conical Hole Tungsten Carbide. Sede 13.6 H= 8, 9, 10, 11, 13, 15	7
05319XW	3 Way Swirl Conical Hole Tungsten Carbide. Sede 19 H= 8, 10, 13, 15	7
0540XX	Nozzle Tungsten Carbide XX= 0.7, 0.8, 1, 1.2, 1.3, 1.4, 1.5, 1.6, 1.7, 1.8, 1.9, 2, 2.1, 2.2, 2.3, 2.4, 2.5, 2.6, 2.7, 2.8, 3, 3.2, 3.4, 3.5, 3.8, 4, 4.5, 5 mm	8
05600	Head P5	10

P6



Code	Description	Pos.
07003X	Body P5 3/4" 3/8"	1
07300	Distributore P6	3
053136XW	3 Way Swirl Conical Hole Tungsten Carbide. Sede 13.6 H=8, 9, 10, 11, 13, 15	7
05319XW	3 Way Swirl Conical Hole Tungsten Carbide. Sede 19 H= 8, 10, 13, 15	7
0540XX	Nozzle Tungsten Carbide XX= 0.7, 0.8, 1, 1.2, 1.3, 1.4, 1.5, 1.6, 1.7, 1.8, 1.9, 2, 2.1, 2.2, 2.3, 2.4, 2.5, 2.6, 2.7, 2.8, 3, 3.2, 3.4, 3.5, 3.8, 4, 4.5, 5 mm	8
05600	Head P1	10